

## PolyFlex™

### Technical Data Sheet

PolyFlex™ is a highly flexible yet easy to print 3D printing material. Featuring good elasticity and a large strain-to-failure, PolyFlex™ opens up a completely new realm of applications.

#### Physical Properties

| Property   | Testing Method                     | Typical Value      |
|--|------------------------------------|--------------------|
| Density (g/cm <sup>3</sup> at 21.5 °C)                 | ASTM D792<br>(ISO 1183, GB/T 1033) | 1.17 - 1.24        |
| Glass transition temperature (°C)                      | DSC, 10 °C/min                     | Not available      |
| Softening temperature of filament<br>(for 1.75 mm; °C) | Custom method                      | Not available      |
| Melt index (g/10 min)                                  | 210 °C, 1.2 kg                     | 10 - 12            |
| Moisture content <sup>1</sup> (%)                      | Thermogravimetric                  | ≤ 0.1%             |
| Odor   | /                                  | Almost odorless    |
| Solubility   | /                                  | Insoluble in water |

Note:

1. For newly opened filaments; filaments may absorb higher levels of moisture during use.

#### Mechanical Properties<sup>1</sup>

| Property                | Testing Method                     | Typical Value |
|-------------------------|------------------------------------|---------------|
| Shore A hardness        | ASTM D2240<br>(ISO 7619, GB/T 531) | ~ 95A         |
| 100% modulus (MPa)      | ASTM D412<br>(ISO 37, GB/T 528)    | 9.4 ± 0.3     |
| Tensile strength (MPa)  | ASTM D412<br>(ISO 37, GB/T 528)    | 29.0 ± 2.8    |
| Elongation at break (%) | ASTM D412<br>(ISO 37, GB/T 528)    | 330.1 ± 14.9  |

Note:

1. All testing specimens were printed using a MakerBot Replicator 2 under the following conditions:  
Printing temperature = 225 °C, printing speed = 90 mm/s, number of shells = 2, and 100% infill.

## Testing Geometries

---

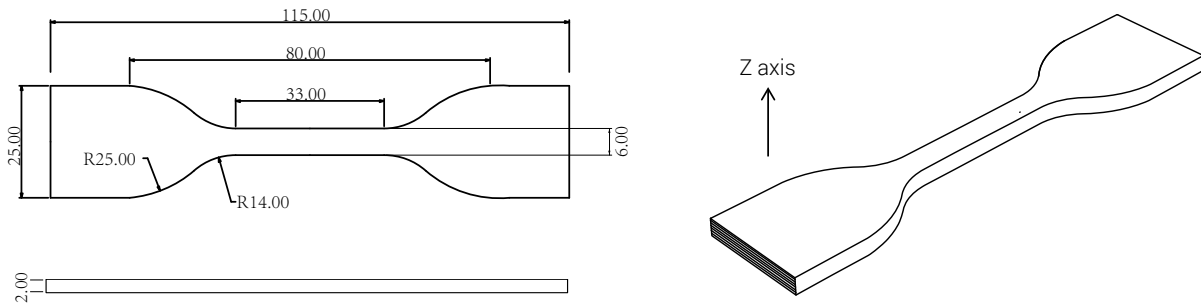


Fig 1. Tensile testing specimen

## Disclaimer

---

The typical values presented in this data sheet are intended for reference and comparison purposes only. They should not be used for design specifications or quality control purposes. Actual values may vary significantly with printing conditions. End-use performance of printed parts depends not only on materials, but also on part design, environmental conditions, printing conditions, etc. Product specifications are subject to change without notice.

Each user is responsible for determining the safety, lawfulness, technical suitability, and disposal/recycling practices of Polymaker materials for the intended application. Polymaker makes no warranty of any kind, unless announced separately, to the fitness for any particular use or application. Polymaker shall not be made liable for any damage, injury or loss induced from the use of Polymaker materials in any particular application.